

---

Written Fuel Summary Report


---

**Tank 1 -Off Bottom**



Clear and Bright to ASTM D4176, no free water, no debris, no MBG, moisture content <200PPM, ISO 4406 17/15/10, flashpoint >55, FAME 0.06%, cetane 48.9, density 826, ATP Test 0 RLU's, DCI 51.85, cloudpoint -5.8.


**Fuel is within specification on tests performed.**



## Written Fuel Summary Report

### Notation

A Bottom sample was obtained from the tank as a reference. A picture of these can be seen below.

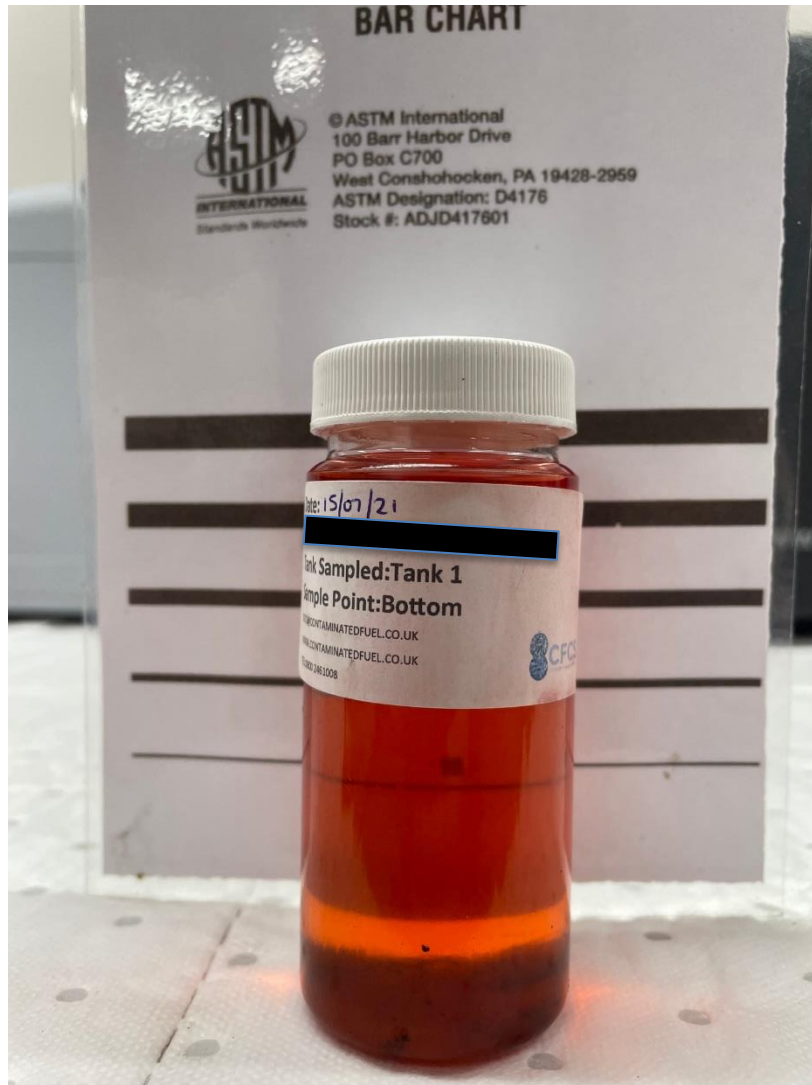

Sample has traces of debris and MBG present. An additional ATP test was performed which gave a reading of 2 RLU's.